


Sketch with main dimensions

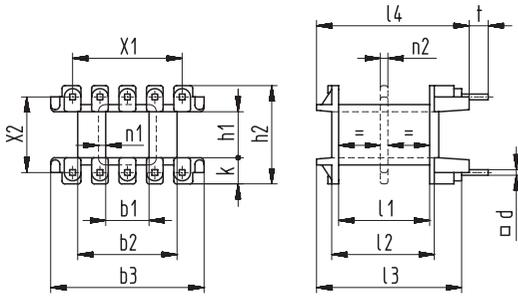


Standard: fully pinned, partial fitting on request.

Matching boxes for Wz 7739:
Art. 3541 - Wz 7774/OS; see page 150.


For spacers see column I4.

ST
with molded-in wires □ 0,6 mm

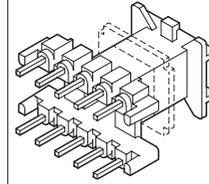

b1	b2	b3	h1	h2	k	l1	l2	l3	l4	n1	n2	d	t	X1	X2	X3 ①	Type	Art.-No.	
±0,1	±0,2	±0,2	±0,1	±0,2	±0,1	±0,2	±0,2	±0,2	±0,3	+0,2	±0,1	±0,1	±0,2	±0,2	±0,2		EE 20/6,1/1 ST EE 20/6,1/2 ST	Wz 7739/1 ST Wz 7739/2 ST	1952 2063
6,1	13,8	22	6,1	13	3,4	12,1	13,9	18,5	20	0,8	0,8	0,6	3,5	4x3,81	10	2x5			

Sketch with main dimensions

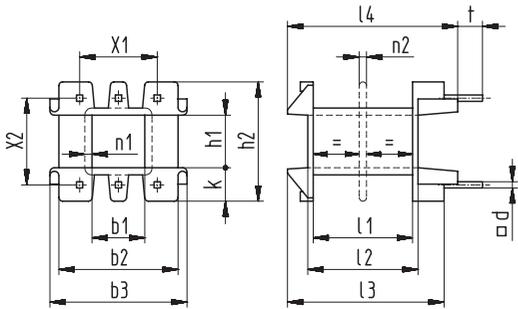


Only fully pinned available.

No matching boxes available at the moment.


For spacers see column I4.

ST
with molded-in wires □ 0,7 mm

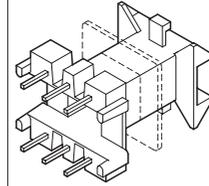

b1	b2	b3	h1	h2	k	l1	l2	l3	l4	n1	n2	d	t	X1	X2	X3 ①	Type	Art.-No.	
±0,1	±0,2	±0,2	±0,1	±0,2	±0,1	±0,2	±0,2	±0,2	±0,3	+0,2	±0,1	±0,1	±0,2	±0,2	±0,2		EE 25/7,7/1 ST EE 25/7,7/2 ST	Wz 7651/1 ST Wz 7651/2 ST	3357 on request
7,8	17,3	19,8	7,8	17,4	4,8	15,6	17,1	24,6	26,6	0,7	-	0,7	3,7	2x5	12,5	2x3			


Sketch with main dimensions

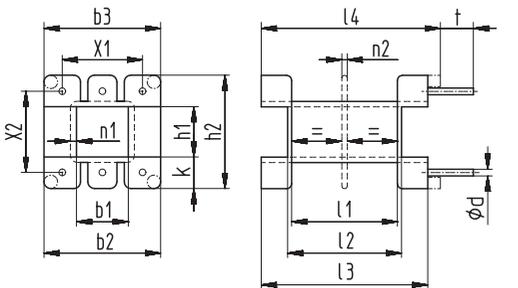

Due to the enlarged pin length t there are matching boxes only for the versions with wire Ø d = 1:
Art. 3232 - Wz 7593/OS; see page 151.

For spacers see column I4.

ST
with pins Ø 0,8 mm / Ø 1,0 mm

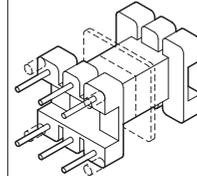


b1	b2	b3	h1	h2	k	l1	l2	l3	l4	n1	n2	d	t	X1	X2	X3 ①	Type	Art.-No.	
±0,1	±0,2	±0,2	±0,1	±0,2	±0,1	±0,2	±0,2	±0,2	±0,3	+0,2	±0,1	±0,1	±0,2	±0,2	±0,2		EE 25/7,7/1 ST	Wz 6013/1 ST	2776
7,7	17,4	17,4	7,7	17,4	4,8	15,8	17	24,8	-	0,8	-	1	7,8	2x6,3	12,5	2x3			
7,7	17,4	17,4	7,7	17,4	4,8	15,8	17	24,8	-	0,8	-	1	7,8	2x5	12,5	2x3	EE 25/7,7/1 ST	Wz 6013/1 ST	2862
7,7	17,4	17,4	7,7	17,4	4,8	15,8	17	24,8	26,6	0,8	-	1	6	2x5	12,5	2x3	EE 25/7,7/1 ST	Wz 6013/1 ST	2090
7,7	17,4	17,4	7,7	17,4	4,7	15,8	17	24,8	26,8	0,8	-	0,8	3,6	2x5	12,5	2x3	EE 25/7,7/1 ST-So	Wz 6013/1 ST-So ⑥	6164

① X3 = max. number of slots or terminals

⑥ Not recommended for use in boxes.


Sketch with main dimensions

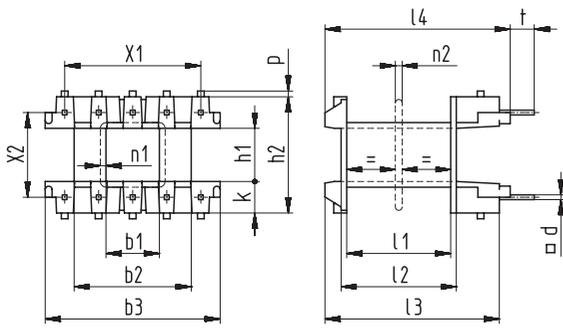

Standard: fully pinned, partial pinning on request.


Matching boxes:
Art. 3232 - Wz 7593/OS; see page 151.
For spacers see column I4.
Height of spacers p=0,85mm

ST
with molded-in wires □ 0,7 mm

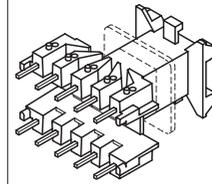


b1	b2	b3	n1	n2	k	l1	l2	l3	l4	n1	n2	d	t	X1	X2	X3 ①	Type	Art.-No.	
±0,1	±0,2	±0,2	±0,1	±0,2	±0,1	±0,2	±0,2	±0,2	±0,3	+0,2	±0,1	±0,1	±0,2	±0,2	±0,2		EE 25/7,7/1 ST	Wz 7764/1 ST	2752
7,9	17,3	26	7,9	18,5	4,7	15,4	17,1	27,4	29	0,8	-	0,7	3,5	4x5,04	12,6	2x5	EE 25/7,7/2 ST	Wz 7764/2 ST	on request

Sketch with main dimensions

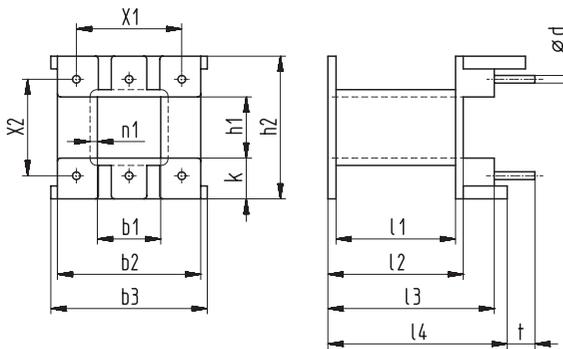


Matching boxes:
Art. 2522 - Wz 2096/OS; see page 151.
For spacers see column I4.
Wz 7713 with an additional spacer for orientation.

ST
with pins Ø 1,0 mm

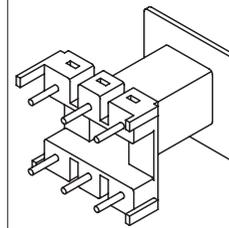

b1	b2	b3	n1	h1	h2	k	l1	l2	l3	l4	n1	d	t	X1	X2	X3 ①	Type	Art.-No.	
±0,1	±0,2	±0,2	±0,1	±0,1	±0,2	±0,1	±0,2	±0,2	±0,2	±0,3	+0,2	±0,1	±0,2	±0,2	±0,2		EE 32/9,8/1 ST	Wz 7089/1 ST	2591
9,9	21,9	24,1	9,9	22,1	6,1	20,1	22	27	29	0,9	1	4,2	2x7,5	15	2x3		EE 32/9,8/1 ST	Wz 7713/1 ST	3481


Sketch with main dimensions

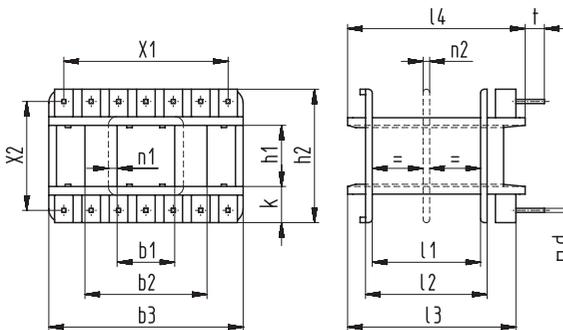

Standard: fully pinned, partial pinning on request.

Matching boxes:
Art. 3573 - Wz 7841/OS; see page 151.
For spacers see column I4.

ST
with molded-in wires □ 0,75 mm

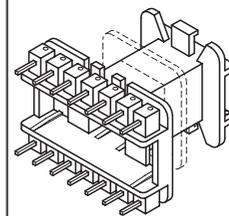

b1	b2	b3	n1	n2	k	l1	l2	l3	l4	n1	n2	d	t	X1	X2	X3 ①	Type	Art.-No.	
±0,1	±0,2	±0,2	±0,1	±0,2	±0,1	±0,2	±0,2	±0,2	±0,3	+0,2	±0,1	±0,1	±0,2	±0,2	±0,2		EE 32/11/1 ST	Wz 7837/1 ST	3571
9,8	22,5	35,5	11,2	24,5	6,6	20,2	22,2	31,2	32,9	1	-	0,75	3,5	6x5	20	2x7			

① X3 = max. number of slots or terminals